

# Installation Instructions

## R-800 I Deadbreak Elbow with Fully Integral 200A Loadbreak Tap Plug

### Applicable Fastener Type

H Style

### Applicable Voltage Classes

15kV

25kV

### Applicable Catalog Prefix

#### 15kV Class

618  
718  
918

#### 25kV Class

628  
728  
928

### For Use With the Following Cable Types

Jacketed Concentric Neutral (JCN)  
Longitudinally Corrugated Neutral (LC)  
Tape Shield Neutral






## WARNING

- System must be de-energized during installation or future operation of this product or its components.
- Do not touch or move energized connectors or components by hand.
- Excess distortion of the assembled connector may result in its failure.
- Failure to follow these instructions will result in damage to the connector and serious or fatal injury.
- This product should only be installed and/or operated by trained personnel in accordance with normal and safe work procedures.
- Variations in equipment or configuration or work procedures may not be covered in these instructions.
- Please contact Richards Manufacturing for any additional questions.

## KIT CONTENTS

Standard kits may include the following. Custom kits may vary.

Check package contents to be sure they are complete, undamaged, and properly sized for the application.

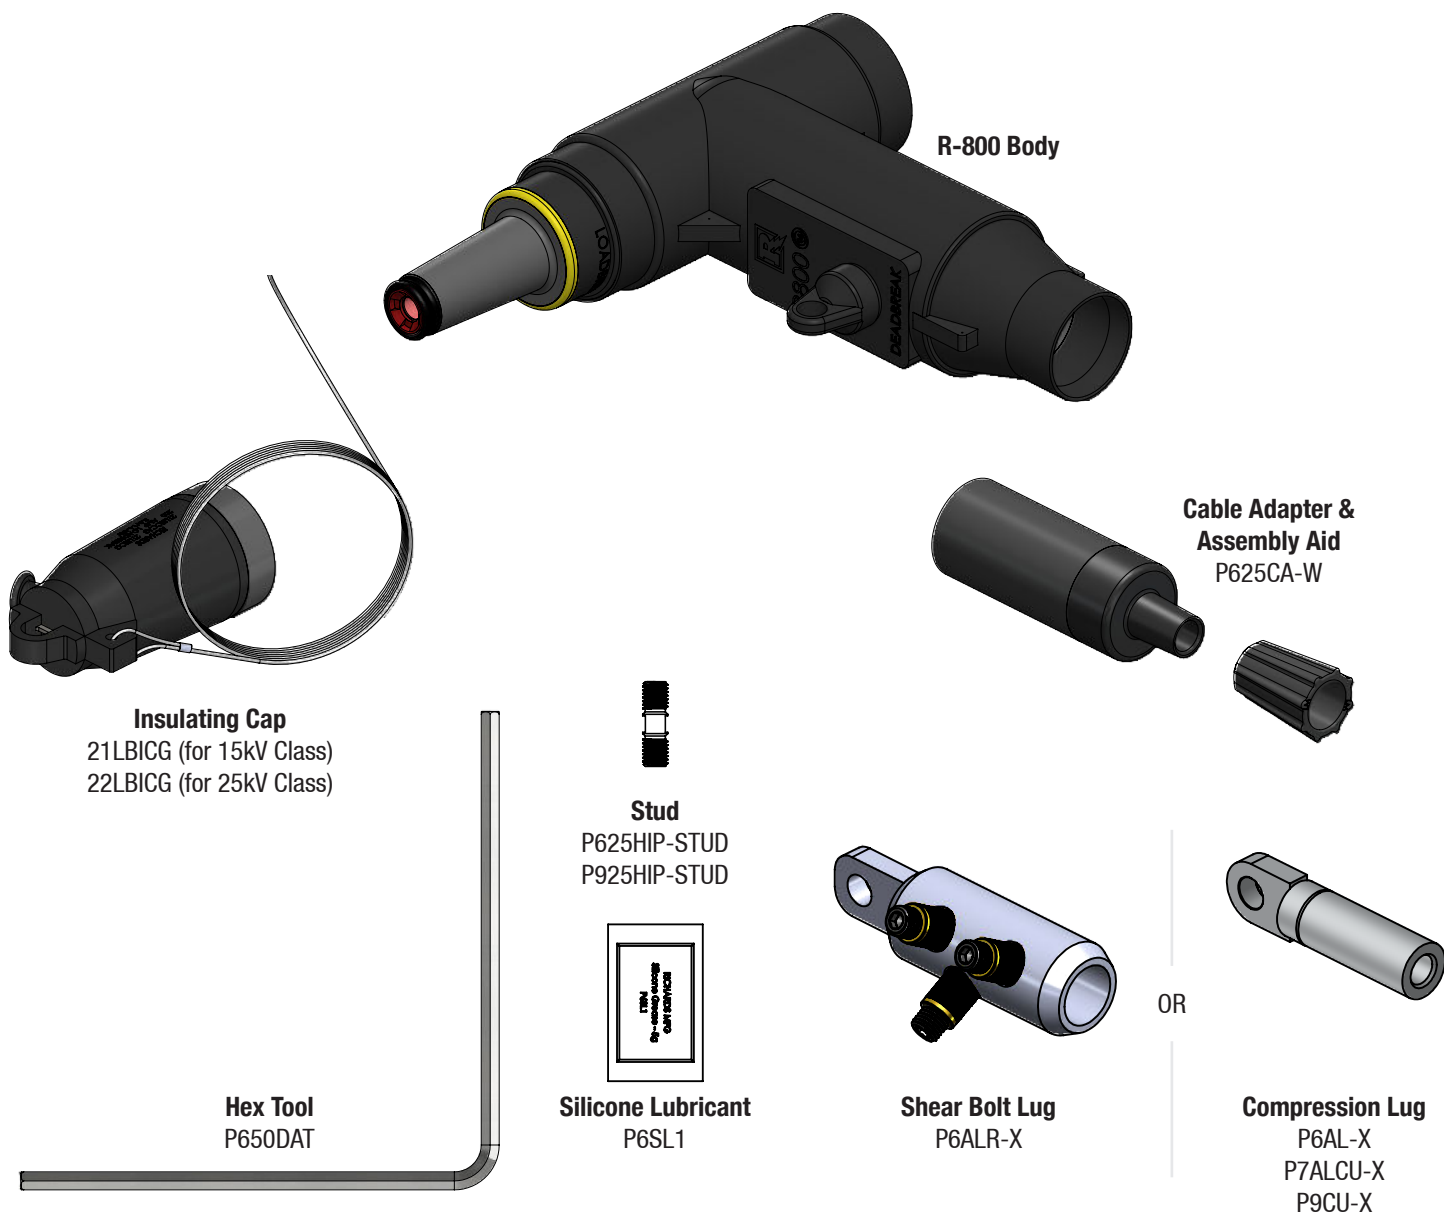


**TIP:** Use To-Scale Cable Cutback Template as aid to prepare cable.

**NOTE:** Certain items used, such as PVC tape, may not be included.

# 1

## Positioning Cable

- A. Straighten and train cable end. Cable should be free to move approximately 2" in either direction.
- B. Cut cable to dimensions shown.
- C. Clean cable jacket approximately 24" from end of cable.

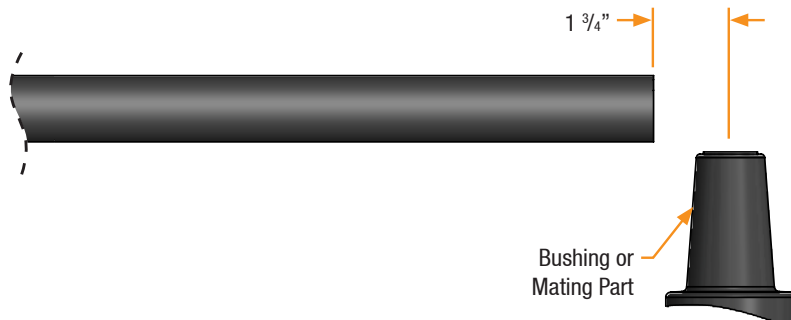


# 2

## Exposing Cable Shielding

- A. Remove cable jacket to dimensions shown.
- B. Abrade area as shown.


**NOTE:** Cable Shielding may be wires, straps, metallic tape, or LC tape. (Wires shown as example)

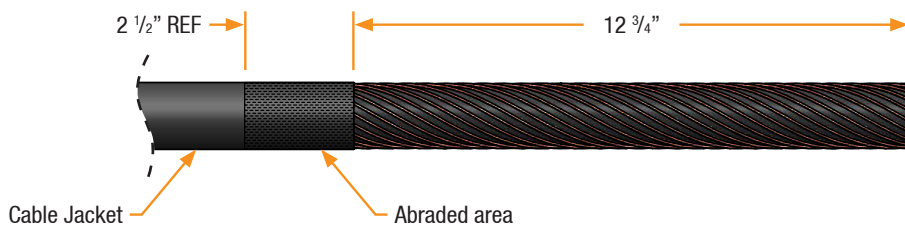

# 3

## Applying Jacket Mastic

- A. Apply jacket mastic at position shown by stretching and wrapping with light tension fully around outer jacket.

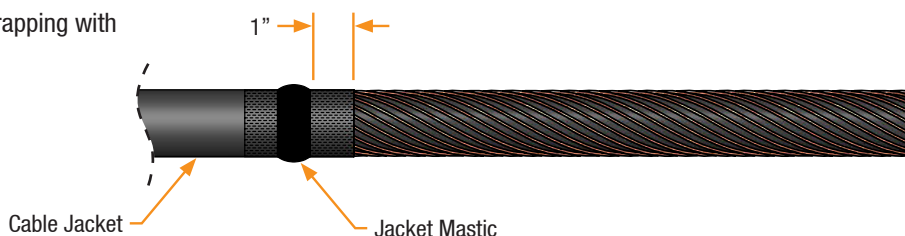


# 4

## Exposing Cable Semi-Conductive Shield


### For Strap/Wire Shielded Cable

- A. Fold back strap/wire shields and press firmly into jacket mastic.
- B. Secure strap/wire shields to cable with PVC tape as shown.

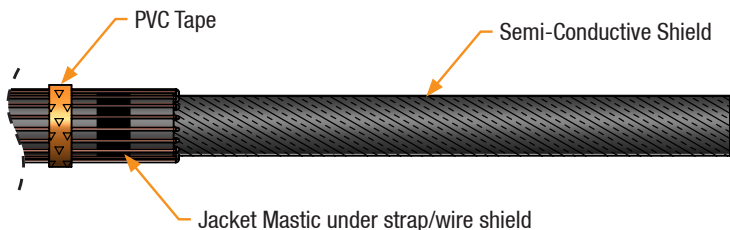

### For Metallic Tape/LC Shielded Cable

- A. Wrap PVC tape at dimension shown to secure metallic shield.
- B. Remove metallic shield up to PVC tape.

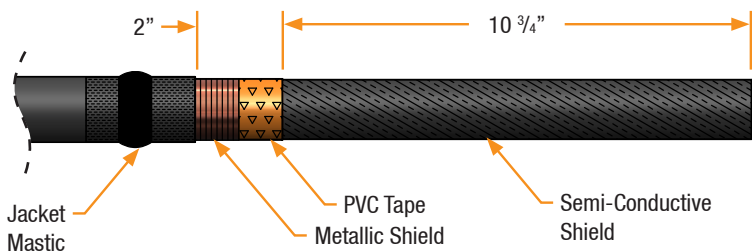

# 5


## Exposing Cable Insulation

### For Strap/Wire Shielded Cable

- Remove semi-conductive shield to dimensions shown.
- Place PVC tape marker at dimension shown.



**WARNING: Do not nick or cut the cable insulation.**

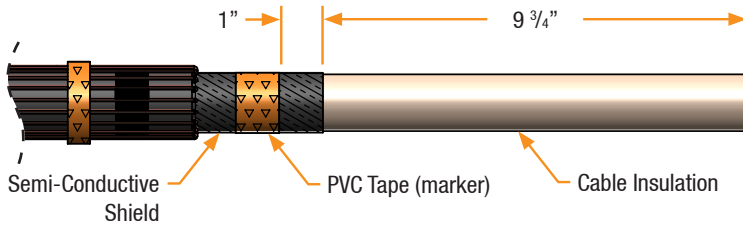


### For Metallic Tape/LC Shielded Cable

- Remove semi-conductive shield to dimensions shown.
- Check that tape from previous step is 1" from the edge of the semi-conductive shield as it will serve as a marker.



**WARNING: Do not nick or cut the cable insulation.**

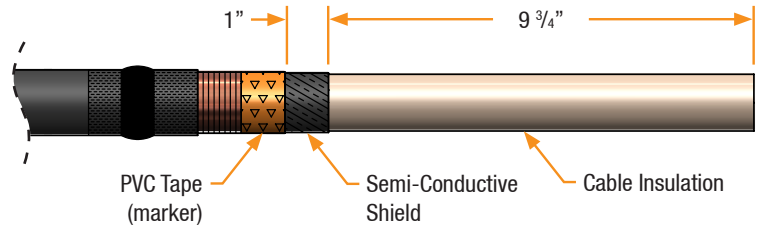

# 6

## Preparing Metallic Shield


### For Strap/Wire Shielded Cable

Proceed to next step

### For Metallic Tape/LC Shielded

- Position copper braid so that solder block rests on the jacket mastic.
- Wrap copper braid around metallic shield as shown.
- Wrap constant force spring over wrapped portion of copper braid.
- Wrap 2 layers of PVC tape over constant force spring.
- Press solder block into jacket mastic.
- Secure braid to cable with PVC Tape.

**CHECK:** Confirm that solder block is aligned with jacket mastic.

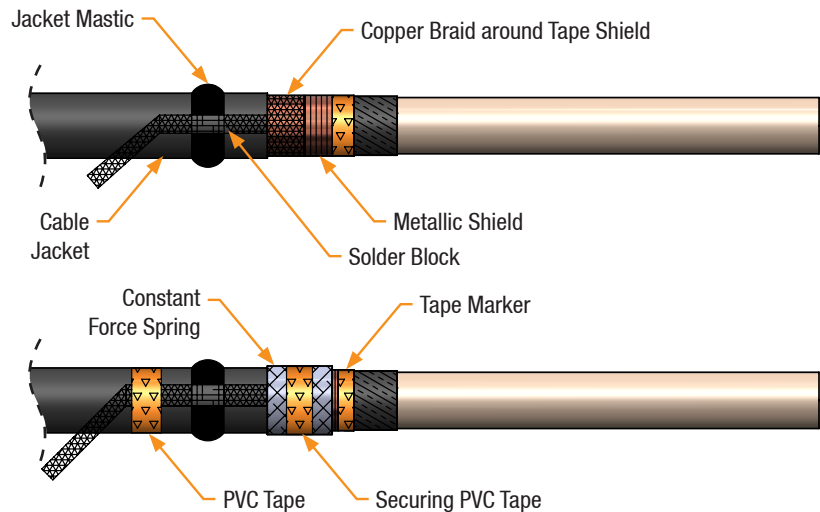


# 7

## Exposing Conductor

- Remove cable insulation. Refer to instructions provided with lug for insulation cutback dimension. Cutback dimension should not exceed  $4 \frac{3}{8}$ ".



**WARNING: Do not nick or cut the conductor strands.**

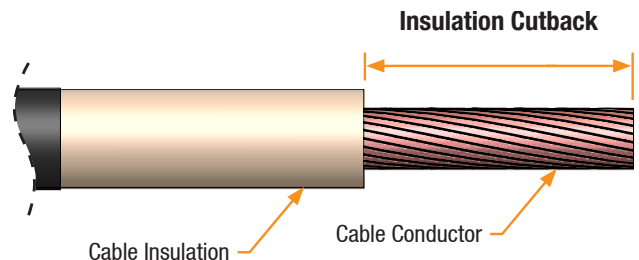


**NOTE:** Confirm all dimensions with To-Scale Cable Cutback Template before proceeding.

# 8


## Parking Jacket Seal Tube

A. Slide jacket seal tube onto cable as shown. If using a cold shrink tube, orient pull tab facing away from cable end.

### For Strap/Wire Shielded Cable

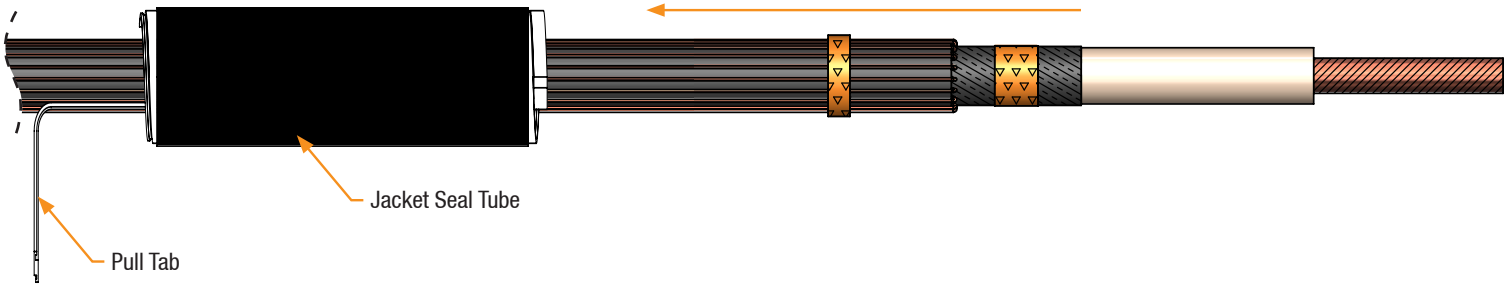


### For Metallic Tape/LC Shielded Cable

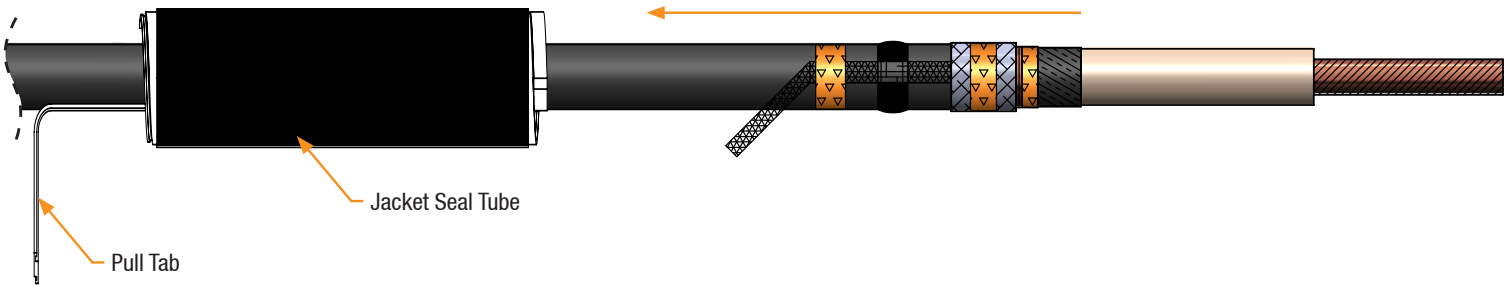


# 9

## Installing Cable Adapter

- Slide cable adapter assembly aid up to insulation.
- Clean insulation with approved cleaning wipes by wiping in direction of semi-conductive shield.
- Apply silicone lubricant to cable insulation, cable adapter assembly aid, and inside of cable adapter as shown.
- Slide cable adapter onto cable until the cable adapter sits flush with the leading edge of the tape marker as shown.

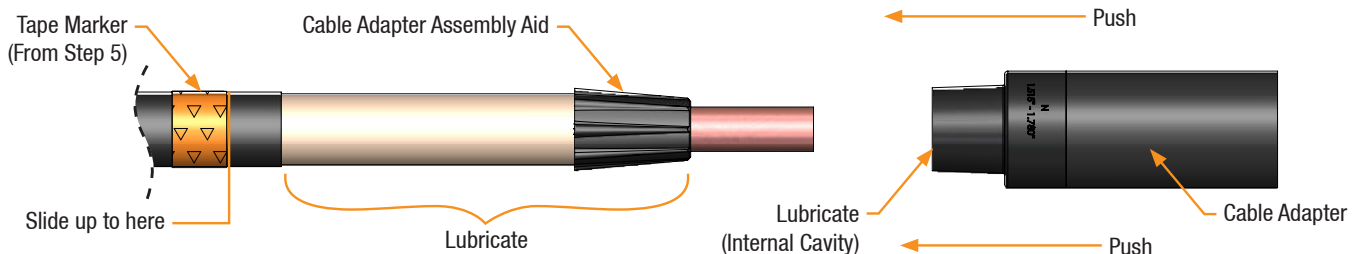

- Remove cable adapter assembly aid.
- Confirm cable adapter is positioned as shown below. Insulation may extend beyond adapter as long as both checks below are confirmed.

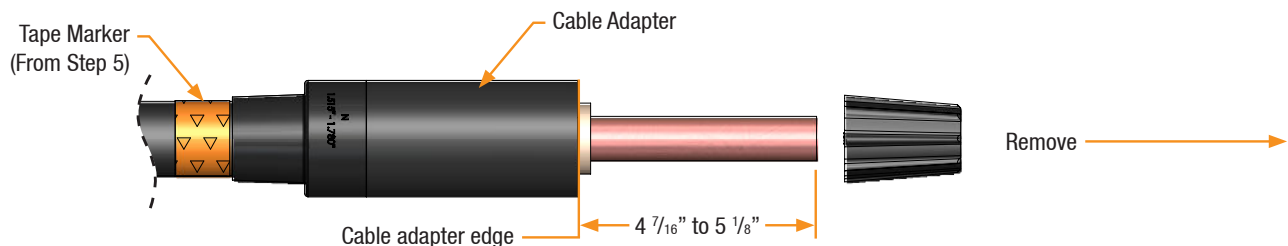

**CHECK:** Confirm that edge of tape marker is flush with end of cable adapter as shown.


**CHECK:** Confirm that dimension from end of conductor to cable adapter edge satisfies criteria shown above.

# 10.1

## Installing Lug

### For Crimp Connectors

- Clean conductor of any debris. For aluminum conductor, wire brush and immediately insert lug onto conductor. Slide lug until the conductor is fully seated within the lug barrel.
- Rotate lug so that spade is parallel to the contact face of the bushing or mating part as shown.
- Select correct tool and die using crimp chart supplied with lug. Crimp lug (min. number indicated in crimp chart) starting just below knurl line adjacent to pad. Carefully wipe any excess inhibitor from lug and cable insulation.

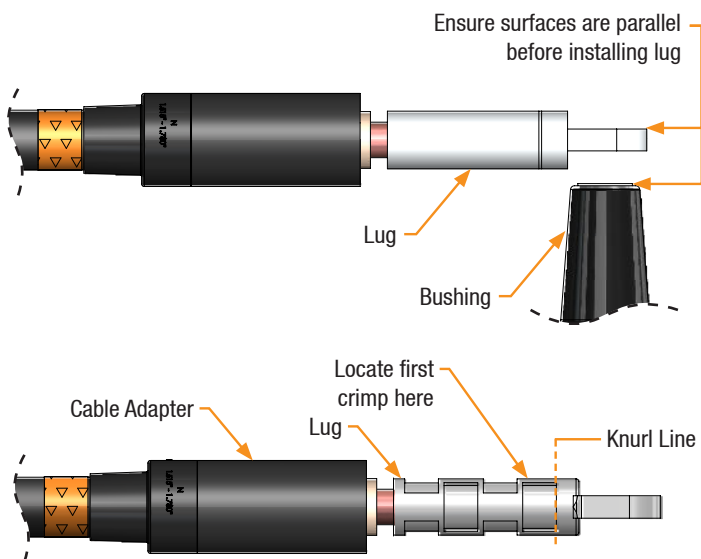


### For Range Taking Connectors


- Refer to lug bag for centering ring selection. Install centering ring into barrel opening. Clean conductor of any debris. For aluminum conductor, wire brush and immediately insert lug onto conductor. Slide lug until the conductor is fully seated within the lug barrel.
- Rotate lug so that spade is parallel to the contact face of the bushing or mating part as shown. Hand tighten shear bolts in tightening sequence shown.

**NOTE:** Your lug may have fewer bolts, but sequence is tightening bolts closest to cable entrance and working way towards spade.

- Fully tighten bolts in tightening sequence shown. The bolt will break free when the required torque value is reached.

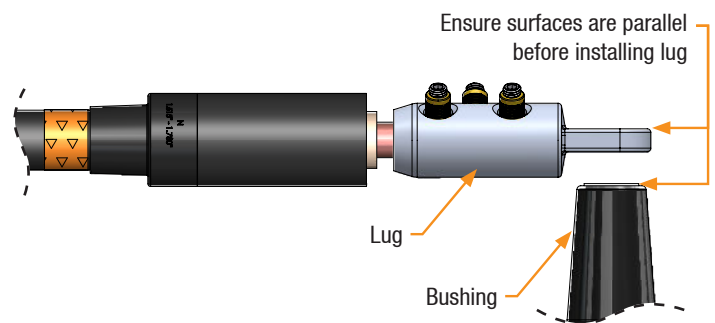

### Bolt Tightening Sequence

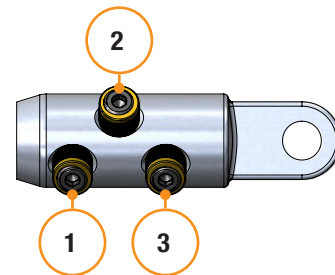


# 10.2

## Checking Lug

- After installing lug, confirm distance from lug end to the cable adapter does not exceed dimension shown.



**WARNING:** Do not exceed maximum dimension shown.

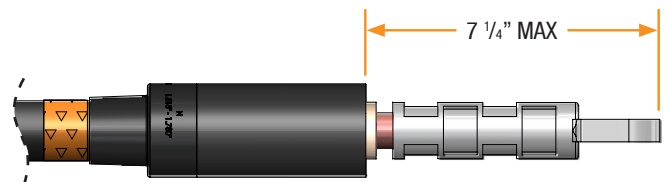

# 11

## Installing R-800 Housing

- A. Clean and lubricate (using supplied or approved silicone grease) entire surface of cable adapter and cable entrance of R-800.
- B. Without moving cable adapter, push R-800 onto cable adapter and slide until lug is fully seated inside R-800. Confirm cable adapter has not shifted by observing tape marker. Cable adapter and tape marker should be aligned as they were in the "Installing Cable Adapter" step.



**WARNING: Confirm cable adapter does not shift from proper positioning during installation of R-800 housing.**

- C. Visually confirm lug spade is completely seated (see Fig. 1).
- D. Measure distance from fixed point on cable (e.g. bottom edge of tape marker) to fixed point on R-800 (e.g. grounding eyelet).



**WARNING: Confirm the lug has fully seated into housing as shown.**

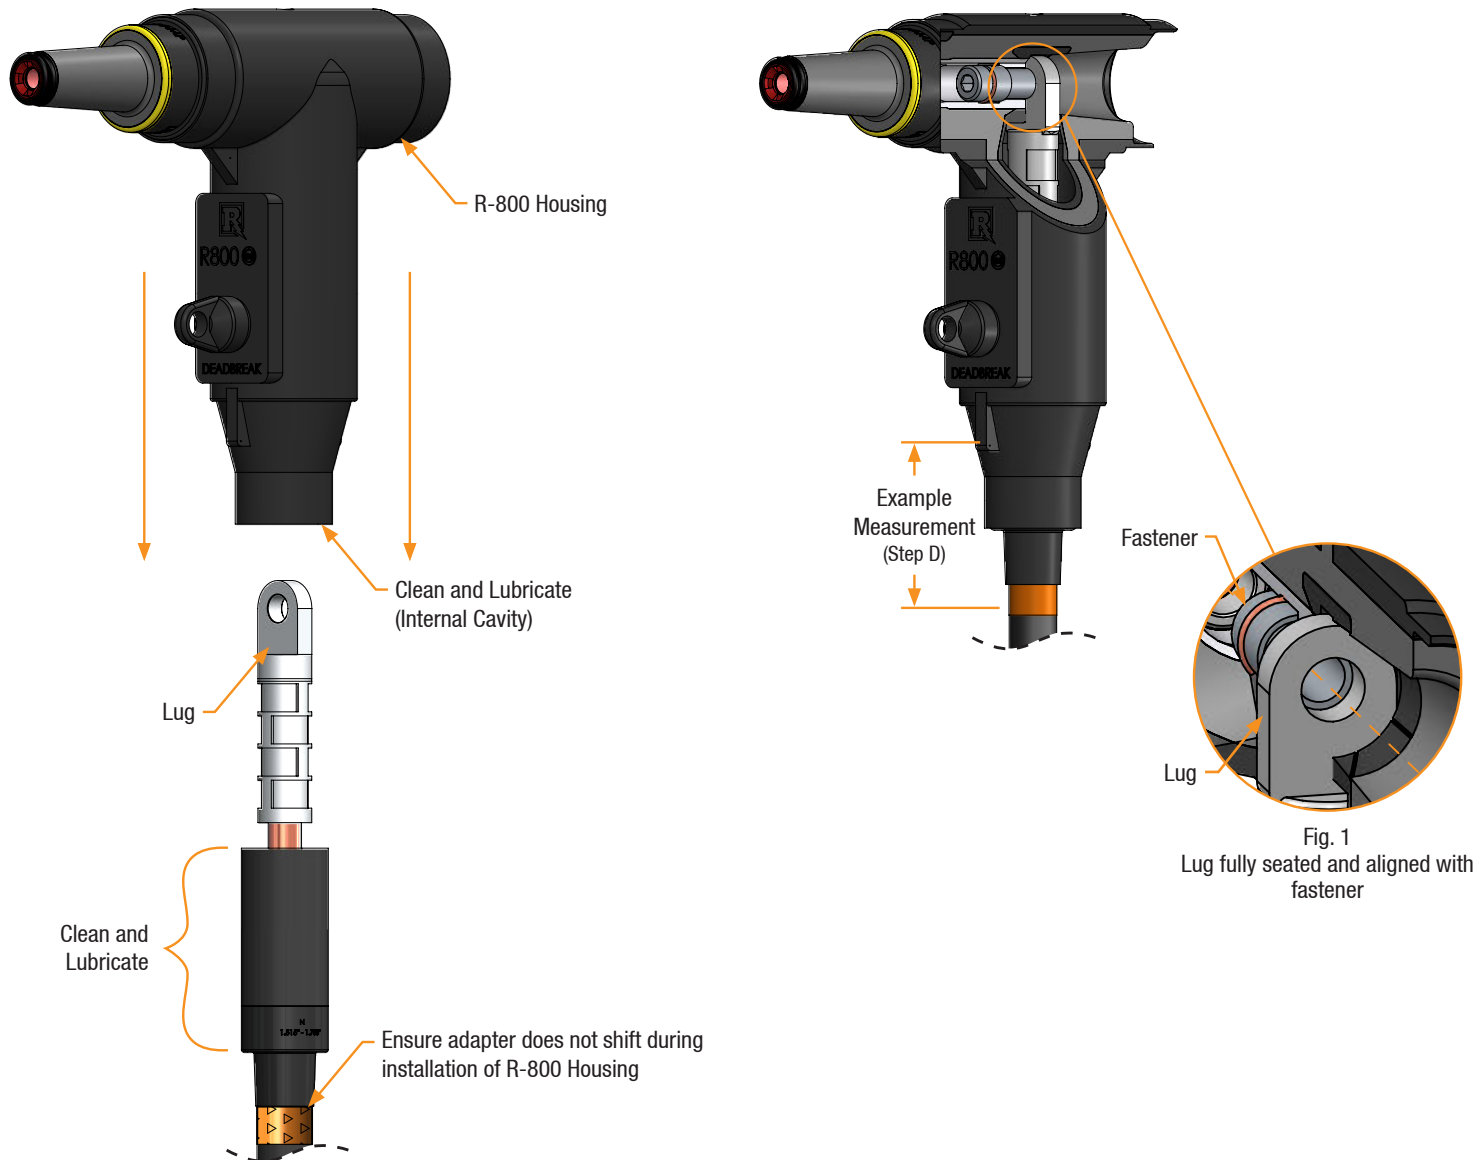


Fig. 1  
Lug fully seated and aligned with fastener



**12****Mounting R-800**

**NOTE:** For installations where the Elbow is either installed but temporarily kept in an unmounted position; or installations where the Elbow must be removed from the bushing/mating component, refer to TEMPORARY/ALTERNATIVE INSTALLATION ADDENDUM at the end of these instructions for specific guidance.

- A. Hand-tighten stud into the appropriate mating part or bushing.



**WARNING:** The stud **MUST** fully thread on. No threads should be visible on the bushing (male) interface. If any threads are visible, confirm correct stud is being used and check for cross-threading/thread damage.

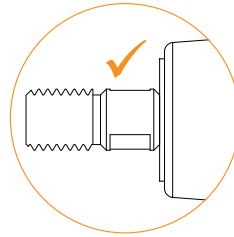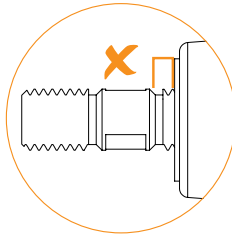

- B. Clean and lubricate (using supplied or approved silicone grease) deadbreak interface of R-800 and interface of mating part or bushing.  
C. Insert supplied hex tool through loadbreak interface, engaging hex broach in the fastener, and extending tool all the way through the lug hole (see Fig. 2).



**WARNING:** Supplied hex tool **MUST** be used for initial mounting/thread engagement. Approved alternate tool such as torque limited tools can be used for final tightening of assembly.

- D. Place one hand on the power cable directly below R-800 and one hand on the body of the R-800. Lifting together, push R-800 onto mating part, lining up the tool (extended through hole in the lug) with the stud on the mating part. Once seated properly the stud will take the place of the tool, extending through the hole in the lug.



**WARNING:** Ensure lug spade is completely seated and stud is through hole in lug.




# 12

## Mounting R-800 (continued)

E. Rotate tool 2-3 turns to start thread engagement.

**!** **CHECK:** Confirm that previously measured distance (from fixed point on cable to fixed point on R-800 body) has not changed more than 3/4". If cable has shifted assembly must be re-done.

F. Continue rotating hex tool. Tighten to 50-60 ft. lbs. The supplied hex tool will twist (see Fig. 3) once the required torque has been achieved.

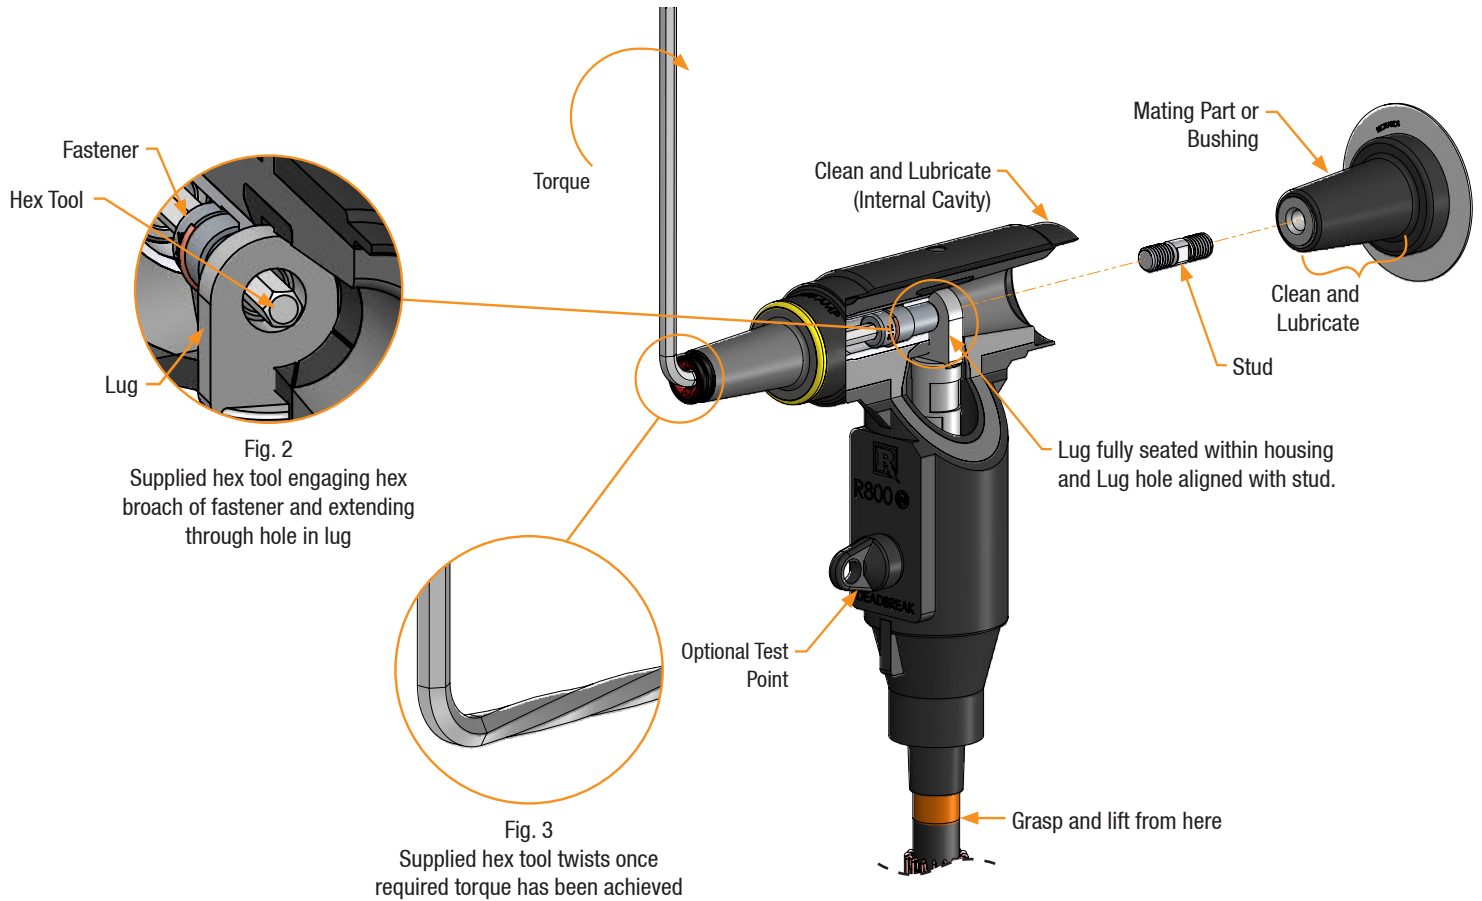


# 13

## Applying Sealing Mastic


### For Strap/Wire Shielded Cable

- Apply sealing mastic over previously applied mastic and on top of folded back neutral wires by stretching and wrapping with light tension.
- Apply sealing mastic by stretching and wrapping with light tension fully around nose of cable adapter for a width of 1" as shown below.

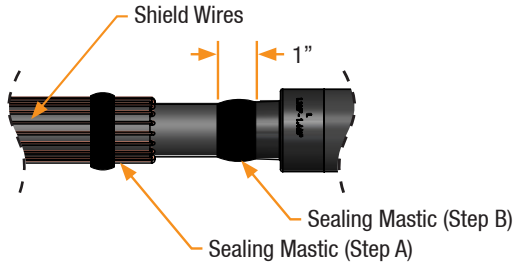

### For Metallic Tape/LC Shielded Cable

- Apply sealing mastic over previously applied mastic and on top of solder block by stretching and wrapping with light tension.
- Apply sealing mastic by stretching and wrapping with light tension fully around nose of cable adapter for a width of 1" as shown below.

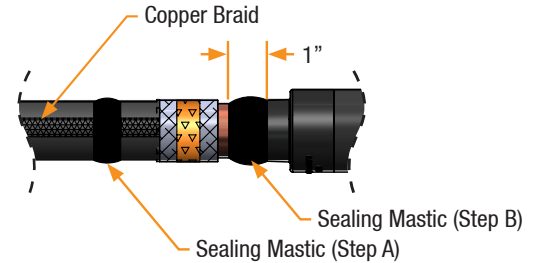


# 14


## Applying Jacket Seal Tube

- Beginning with the side closer to the cable adapter, deploy the jacket seal in area shown below ensuring both mastics are completely covered.

### For Strap/Wire Shielded Cable

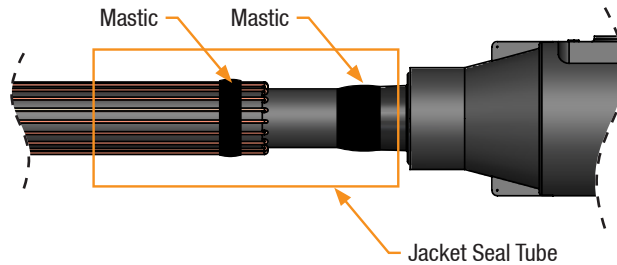


### For Metallic Tape/LC Shielded Cable

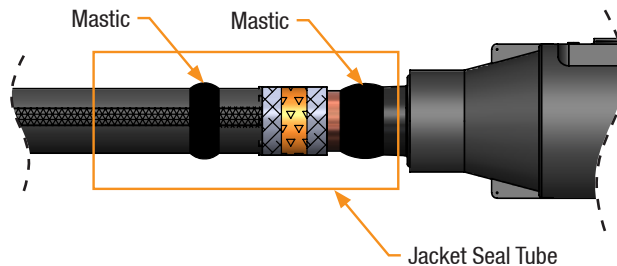

15

Installing Mating Component

- A. Clean and lubricate (using supplied or approved silicone grease) loadbreak interface of R-800 and interface of insulating cap or mating part.
- B. Install mating component per manufacturer instructions. Loadbreak Cap shown as reference.

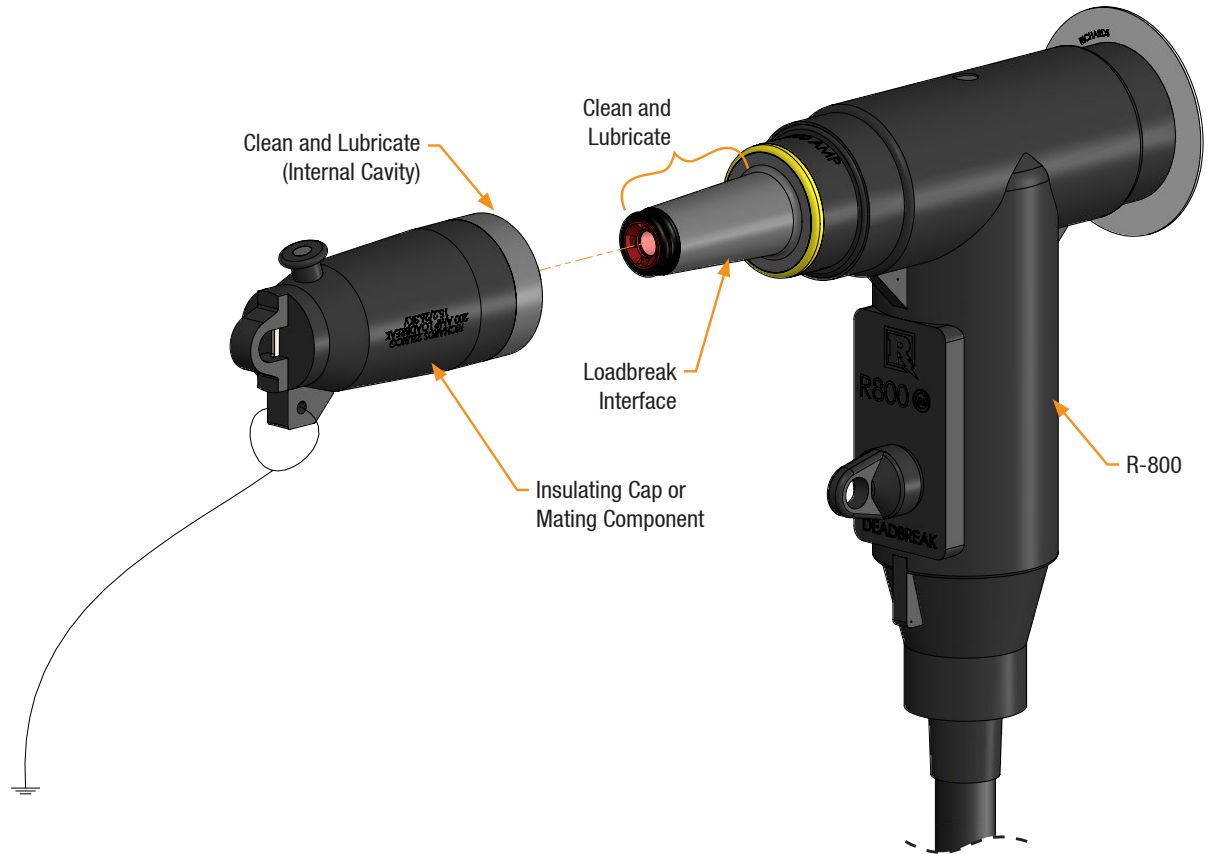


# 16

## Connecting Drain Wires to R-800


### For Strap/Wire Shielded Cable

- Secure neutrals with binding wire or zip tie 1" from jacket seal tube.
- Insert one end of a piece of wire (#14 AWG copper or larger) through one of the available grounding eyes and twist to make a small loop. Be sure not to damage grounding eye.
- Connect other end of wire to shield wires.
- Ground the cable shield according to appropriate/approved practice.

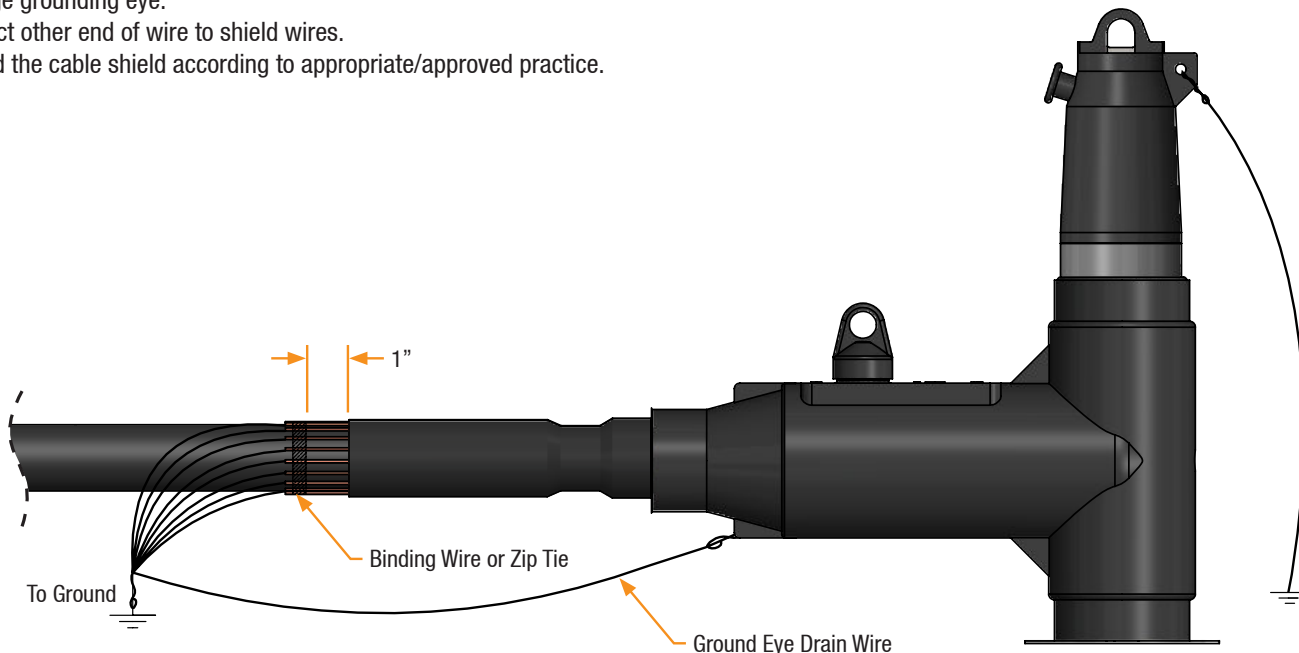

### For Metallic Tape/LC Shielded

- Secure copper braid with binding wire or zip tie 1" from jacket seal tube.
- Insert one end of a piece of wire (#14 AWG copper or larger) through one of the available grounding eyes and twist to make a small loop. Be sure not to damage grounding eye.
- Connect other end of wire to copper braid.
- Ground the cable shield according to appropriate/approved practice.

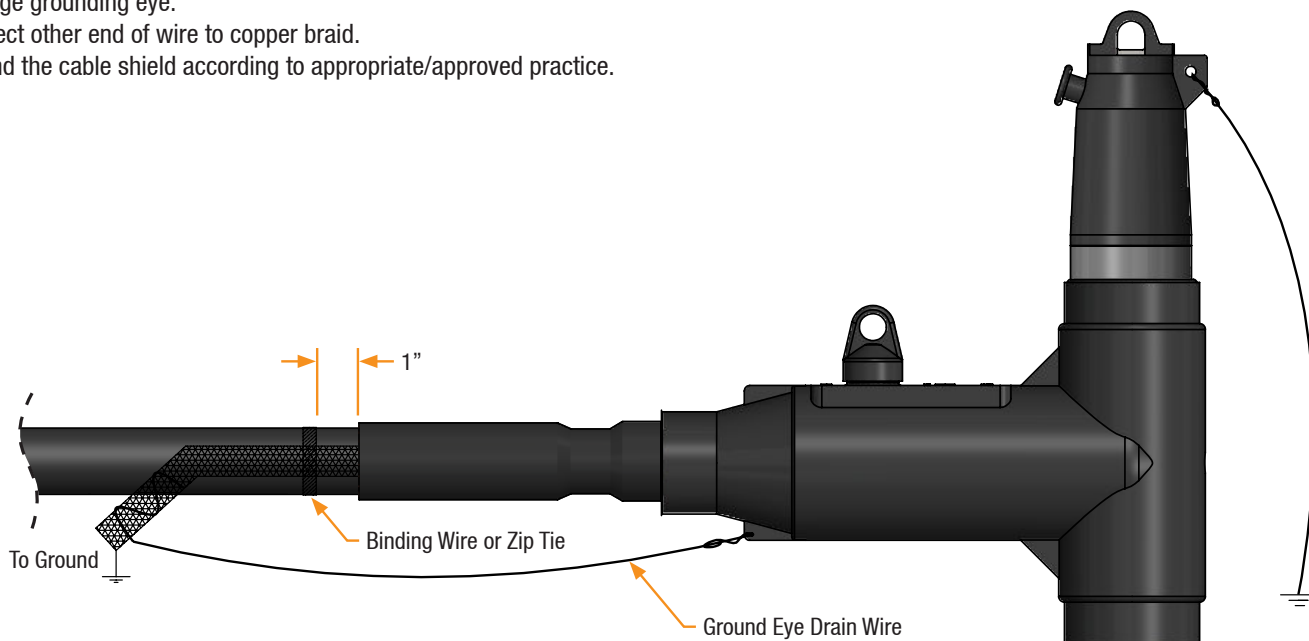


**Installation Complete**

## TEMPORARY/ALTERNATIVE INSTALLATION ADDENDUM:

For installations where the Elbow is either installed but temporarily kept in an unmounted position; or installations where the Elbow must be removed from the bushing/mating component (equipment changeout, cable testing, etc), you **MUST** follow the below guidelines:

- A. Move the cable and Elbow together to avoid disrupting proper positioning between the cable, lug and elbow. Even a Cold Shrink product can be dislodged when moving.
- B. Install appropriate mating components to keep exposed interfaces clean/dry and to capture and maintain correct lug positioning in this temporary configuration. If no mating component is available, you must bag the Elbow to keep interfaces clean/dry and utilize an approved method for maintaining proper lug positioning.
- C. Visually re-confirm alignment and that the lug is fully seated before proceeding with mounting elbow to bushing/mating component.

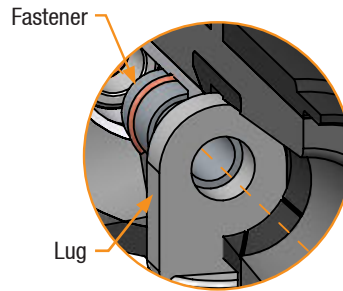

Lug fully seated and aligned with fastener.

- D. After visually confirming alignment, choose a fixed point on the cable (apply a tape marker if necessary) and fixed point on the Elbow (e.g. grounding eyelet) and measure the distance. After performing mounting and starting 2-3 turns of thread engagement, re-measure and confirm distance has not changed more than 3/4". If distance changes by more than 3/4", stop installation and re-align Elbow/lug/cable before proceeding.





